


Defender

Hazard Switch




To 300TDi
and early TD5

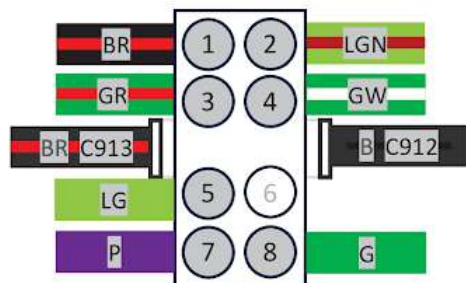

1984-2001
C96

Views from the connector fronts

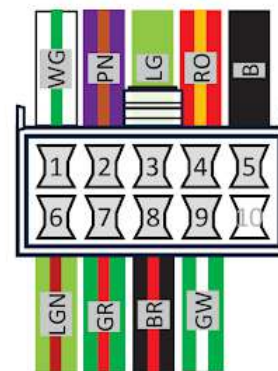

2002-2016
C0096

From late TD5
and TDCi Puma



1984-1998 Wire Colour	1984-2001 Pin Number	2002-2016 Pin Number	1999-2016 Wire Colour	Function	Off	On
	C96-8	1		Ignition live – Puma Fuse 21, 300TDi Fuse 3		
	C96-7	2		Permanent live – Puma Fuse 31, 300TDi Fuse 1		
	C96-5	3		To hazard relay solenoid		
	Binnacle C332-5	4		Legend illumination		
	C912	5		Earth header		
	C96-2	6		From hazard relay switched (and indicator switch)		
	C96-3	7		Turn indicator header – Left		
	C96-1 and C913	8		Instrument cluster warning lamp		
	C96-4	9		Turn indicator header - Right		
--	C96-6	10	--	No pin on the switch		